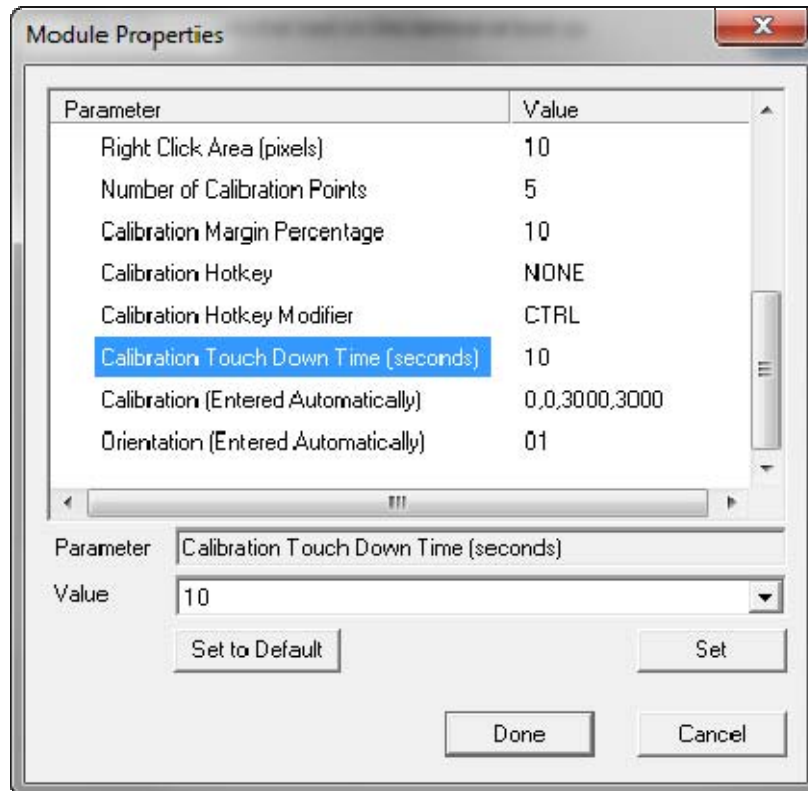# Initiate Calibration at Touch Screen

Use the **F1** button on any page of a ThinManager wizard to launch Help for that page.

Visit www.thinmanager.com/technotes/ to download the manual, manual chapters, or the ThinManual.

ThinManager Touch Screen Modules have a parameter to allow the calibration program to be initiated by a 10, 15, or 20 second touch to the touch screen.

Open the **Terminal Configuration Wizard** for the terminal by double-clicking on it in the ThinManager tree. Navigate to the **Module Selection Page** by selecting the *Next* button.

Highlight the touch screen module and select the *Configure* button to launch the **Module Properties** window.

Calibration by Touch

When the **Module Property** window is open for a touch screen module, set the *Calibrate Touch Down Time (seconds)* parameter to 10,15, or 20 and select the *Set* button to apply any value change for a parameter.

Select the *Done* button to accept the changes and close the **Module Property** window. Select the *Finish* button on the **Module Selection** page of the Terminal Configuration Wizard and restart the thin client to apply the changes.

To initiate the calibration program touch any non-active spot on the screen and hold the finger for the number of seconds selected.

Note: Using the *Calibrate Touch Down Time (seconds)* parameter prevents the usage of both the Application Group Selector (drop-down) and the Right-Click on touch (Right Click Hold Time parameter).